



KITITAS COUNTY COMMUNITY DEVELOPMENT SERVICES

INSPECTION REPORT

PERMIT NUMBER: BP.14.00356

OWNER'S NAME: Wolf-Evans

DATE: 8.11.15

TYPE: Framing

TIME STARTED: 12:45 pm

INSPECTOR: Green

- ① Block roof sheathing panels per Sr. 2 near fireplaces.
- ② Clips at rafter to beam connections.
- ③ Steel Beams at roof → connection of beam on top, rafters.
Ends of beams at Bedroom not fully supported or bolted to post.
- ④ Steel beam at rear porch covered w/o inspection.
- ⑤ Multiple interior headers missing at master.
- ⑥ Re-check all areas required to be safety glass.
- ⑦ Point load blocking in upper floor per plan.
- ⑧ Interior floor to floor hold-downs missing.
- ⑨ Window at upper bedroom #2 does not meet egress.
- ⑩ Rafter tail to truss lag bolt at upper floor.
- ⑪ SDS screws per schedule at bottom plate of Sr2's.
- ⑫ Provide framing detail for entire fireplace chase.

INSTRUCTIONS: Obtain approval from engineer for: #3, #5, #12. Complete others. DO NOT COVER.

NEXT INSPECTION: Re-Framing.

RE-INSPECTION FEE DUE? NO YES \$ 0

IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:

amber.green @co.kittitas.wa.us