INSPECTION REPORT

PERMI	T NUMBER:	BP-14-00397	OWNER'S NAME:	CAREY	
DATE:		9/15/2015	TYPE:	Framing	
TIME STARTED:		4:16 PM	INSPECTOR:	Jessica Contratto	
MAP NUMBER:		21-14-34061-0004			
	1. BCI web s	BCI web stiifeners required on upper roof framing. Clarification on where needed			
	2. front retaining wall requires engineering				
	3. solid blocking 24"oc for 2 bays where joists parallel basement wall per detail page A7				
	4. fire block in stairwells				
	5. provide literature from BCI for seat cuts on joists and outlooker attachment				
	6. vented windows ok				
	7. gas line pressure needs to be 15# minimum				
	8. lateral load tension attachment required for decks ledgered to house. See plan review h				
	andout				
INSTRUCTIONS: complete above, call for re-inspection					
NEXT INSPECTION: re-inspection					
RE-INSPECTION FEE DUE? VES \$					
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION					
QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:					
	iessica.contratto @co.kittitas.wa.us				
 INSPECTION REQUEST LINE: <u>www.co.kittitas.wa.us/cds/request.asp</u> or 509-962-7694 ◆ 411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 ◆ Main Office Line: 509-962-7506 					