



KITTITAS COUNTY COMMUNITY DEVELOPMENT SERVICES

## INSPECTION REPORT

PERMIT NUMBER: BP-14-00449

OWNER'S NAME: SINNETT

DATE: 6/9/2015

TYPE: Framing

TIME STARTED: 9:45 AM

INSPECTOR: Justin Bennett

MAP NUMBER: 20-14-14050-0925

	1. Additional Bracing Required on D4 Trusses. D4 Gable End Truss Kicker Required.
	2. All Fireplace(s) Venting and Draftstop Not Complete.
	3. D5 Trusses Require Additional Bracing.
	4. C2 Gable End Strongback Required.
	5. A35's on Stairwell Not Installed.
	6. Additional Bracing on Edge Web of C3 Web.
	7. Draftstop Required on Bedroom 4 Duct Chase.
	8. Missed Bearing Point of Truss on E6, E7, E8, E9, E10.
	9. Additional Bracing Required on E6, E7, E8, E9, E10 Trusses.
	10. Bracing Missing on B1 and B2 Trusses.
	11. Bracing Missing on F3 Truss
	12. Incomplete Draftstop at Master Bedroom Duct Chase and Fireplace
	13. Truss Bracing Required a A2, A3, A4 and A5.

INSTRUCTIONS: Make corrections above

NEXT INSPECTION: Insulation

RE-INSPECTION FEE DUE?



NO



YES

\$ \_\_\_\_\_

**IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION**

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:

justin.bennett@co.kittitas.wa.us

• INSPECTION REQUEST LINE: [www.co.kittitas.wa.us/cds/request.asp](http://www.co.kittitas.wa.us/cds/request.asp) or 509-962-7694 •

411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506



KITTITAS COUNTY COMMUNITY DEVELOPMENT SERVICES

## INSPECTION REPORT

PERMIT NUMBER: BP-14-00449      OWNER'S NAME: SINNETT  
DATE: 6/9/2015      TYPE: Framing  
TIME STARTED: 9:45 AM      INSPECTOR: Justin Bennett  
MAP NUMBER: 20-14-14050-0925

	Page 2
	14. Hanger Required on J1 Truss at Corner.
	15. Bedrooms 2 & 3 Shearwalls Infill Cut Studs and Nail. Infill Missing Edge Blocking.
	16. Beam O2A Over Stairwell Not Per Plan.
	17. Knee Brace at E10 Truss Not Bearing
	18. Infill Knotched Studs at Bunk Room
	19. Plate to Beam at Bonus Room All 4 Corners
	20. L Strap at Bonus Duct Chase
	21. Coil Strap at Plate Break Over Stairwell Window Both Sides.
	22. Post Down Entry Way ?Purlins at Stair Wall and Front Door
	23. Additional Support at Stair Jack to Ledger in Entry Stairwell.
	24. Plate to Beam Connection on Fireplace Side Beam of Master. Both Ends of Beam.
	25. Straps @ top plate both sides in Craft Room

INSTRUCTIONS: Make corrections above

NEXT INSPECTION: Insulation

RE-INSPECTION FEE DUE? ☒ NO ☐ YES \$ \_\_\_\_\_

**IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION**

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:

justin.bennett @co.kittitas.wa.us

• INSPECTION REQUEST LINE: [www.co.kittitas.wa.us/cds/request.asp](http://www.co.kittitas.wa.us/cds/request.asp) or 509-962-7694 •

411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506



KITTITAS COUNTY COMMUNITY DEVELOPMENT SERVICES

## INSPECTION REPORT

PERMIT NUMBER: BP-14-00449

OWNER'S NAME: SINNETT

DATE: 6/9/2015

TYPE: Framing

TIME STARTED: 9:45 AM

INSPECTOR: Justin Bennett

MAP NUMBER: 20-14-14050-0925

	Page 3
	26. Thrust block at garage stairwell beam
	27. Stair thrust block at stringer in Cellar

INSTRUCTIONS: Make corrections above

NEXT INSPECTION: Insulation

RE-INSPECTION FEE DUE?



NO



YES

\$ \_\_\_\_\_

**IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION**

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:

justin.bennett@co.kittitas.wa.us

• INSPECTION REQUEST LINE: [www.co.kittitas.wa.us/cds/request.asp](http://www.co.kittitas.wa.us/cds/request.asp) or 509-962-7694 •

411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506