



KITITAS COUNTY COMMUNITY DEVELOPMENT SERVICES

INSPECTION REPORT

PERMIT NUMBER: BP-15-00208 OWNER'S NAME: FEASTER
DATE: 11/13/2015 TYPE: Framing
TIME STARTED: 12:07 PM INSPECTOR: Jeremy Haberman
MAP NUMBER: 20-14-24050-0112

	1. NOTE: MECHANICAL INSPECTION NOT REQUESTED. MECHANICAL INSPECTION REQUIRED INSPECTION.
	2. ACCESS TO LOFT NOT PROVIDED FOR INSPECTION OF MECHANICAL SYSTEMS.
	3. Gas Line at 0#. 15#/15min. Minimum PSI Required.
	4. Rough In For Freestanding Stove OK. Inspector to Verify Permit For Stove Is Issued.
	5. NOTE: Combustion Air Intake Must Be Provided to Stove for Final. Stove Not On Exterior Wall or Over Crawl Space. Confirm How Air Intake Will be Provided.
	6. Truss Sheets for Girder Trusses in Casita Not On Site.
	7. Roof Sheathing Insulated Prior to OK to Insulate. Unable to Verify Dimension of Rafter Due to Thickness of Spray Foam. Remove Area of Foam for Rafter Dimension/Depth Verification.
	8. (2) 2x6 Header Required at Bedroom and Bathroom Windows. Provide Engineers OK for Alternative.

INSTRUCTIONS: Make Corrections Above. DO NOT INSULATE.

NEXT INSPECTION: Framing ReInspection.

RE-INSPECTION FEE DUE? NO YES \$ _____
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:

_____ jeremy.haberman @co.kittitas.wa.us

• INSPECTION REQUEST LINE: www.co.kittitas.wa.us/cds/request.asp or 509-962-7694 •
411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506



KITITITAS COUNTY COMMUNITY DEVELOPMENT SERVICES

INSPECTION REPORT

PERMIT NUMBER: BP-15-00208 OWNER'S NAME: FEASTER
 DATE: 11/13/2015 TYPE: Framing
 TIME STARTED: 12:07 PM INSPECTOR: Jeremy Haberman
 MAP NUMBER: 20-14-24050-0112

	Page 2
	9. 4x8 Header at Doorway to Bedroom and Bathroom Requires (2) 2x4 Trimmers Each Side. Provide Engineers OK for Alternate.
	10. 4x12 DF Beam Requires Solid Posting to Floor in Back of Laundry Alcove. Provide Engineers OK for Alternate.
	11. Unable to Verify Installation of A35's Per Detail 6 on S2.3. Remove Foam for Verification of Several A35's.
	12. (2) 2x6 Headers Required On All Small Windows in SE Wall.
	13. Trimmers To Header Not Present On (2) Windows in SE Exterior Wall.
	14. NOTE: Photos Saved to Drive.

INSTRUCTIONS: Make Corrections Above. DO NOT INSULATE.

NEXT INSPECTION: Framing ReInspection.

RE-INSPECTION FEE DUE? NO YES \$ _____
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS:

_____ jeremy.haberman @co.kittitas.wa.us

• **INSPECTION REQUEST LINE:** www.co.kittitas.wa.us/cds/request.asp or 509-962-7694 •
 411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506