INSPECTION REPORT

TYPE:

OWNER'S NAME: HOUSER

Framing

PERMIT NUMBER: BP-16-00404

DATE:

7/11/2017

ADDRESS:

TIME STARTED:	9:23 AM	INSPECTOR:	Justin Bennett
THE STARTED.		Mor Ecron.	odotin Bermett
MAP NUMBER:	20-14-36050-0411		
Plumbing corrections not complete - nail plates			
2. Provide inverted hanger @ eyebrow roof per detail on page 6			
3. Mechanical not installed			
4. Electrical not installed			
5. NOTE: HOT DIPPED GALV FASTNERS ARE REQUIRED @ PT CONNECTIONS			
6. Provide Deck ledger attachement Detail			
7. Install DTTZ @ deck ledger per dwgs			
 Provide 6x6 @ each leading edge of deck - clouded on dwgs Entry roof not per dwgs - 2x10 rafters required/6x10 beams 			
10. Entry post to beam connection is galv bracket with electro plated screws			
11. NOTE: Framing inspection not complete for electrical/mech not installed/corr			
ections outstanding and Framing issues			
12. Truss sheets not on site			
13. Provide engineering with Header requirements			
14. NOTE: BRING OFFICE COPY OF PLANS NEXT INSPECTION			
INCTRUCTIONS: *F	Pring Office Copy of Plans/Comp	loto abovo correcti	ons/Po Inspect
INSTRUCTIONS: *Bring Office Copy of Plans/Complete above corrections/Re-Inspect Plumb&Mech/Have electrical installed prior to Framing Re-Inspection			
r ambameen have electrical instance prior to rearming the inspection			
NEXT INSPECTION: Plumb/Mech			
RE-INSPECTION FEE DUE? VES \$			
IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION			

INSPECTION REQUEST LINE: 509-962-7694

QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL

<u>iustin.bennett</u> @co.kittitas.wa.us

http://www.co.kittitas.wa.us/cds/building/inspection-request.aspx 411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506