INSPECTION REPORT

PERMIT NUMBER: BP-15-00207 OWNER'S NAME: IVERSON

| DATE: | | 9/14/2015 | TYPE: | Re-inspection | | | |
|--|--|------------------|------------|-----------------|--|--|--|
| TIME STARTED: | | 12:50 PM | INSPECTOR: | Jeremy Haberman | | | |
| MAP NUMBER: | | 20-14-19053-0002 | | | | | |
| | Mechanical Venting Not Connected to Exhaust Boot in Roof. Hanging But Not Connected. | | | | | | |
| | 2. Additional Outlookers have Been Installed Per Previous Correction. However, Spacing is | | | | | | |
| | Not 24" at Tails, Approx. Distance from Last Outlooker to Fascia is 48". | | | | | | |
| | 3. Truss Modification at Entry is Acceptable per Engineer and Truss Manufacturer. Positive | | | | | | |
| | Connection Required on (4) Trusses. Truss Screw is Acceptable. | | | | | | |
| | 4. Drawings Require 3/4 inch Roof Sheathing. Sheathing installed is labeled o.688 inch. Pr | | | | | | |
| | ovided Correction. | | | | | | |
| | 5. 2x6's Blocks Not installed per Detail 6/S4. Detail Requires NAiling thru Roof Sheathing | | | | | | |
| | . Blocks Installed Using Construction Adhesive. Provide Engineers LEtter Detailing Attachm | | | | | | |
| | ent Alternate. | | | | | | |
| | 6. Porch Revision Header Provided Indicates LSL be Used. GluLam installed. Revision Indica | | | | | | |
| | tes (1) LSL 4' and (1) LSL 6'. Enginners Intention Unclear. Provide Supplemental or Correc | | | | | | |
| | ted Drawing. Building Must Match Drawing. | | | | | | |
| INSTRUCTIONS: | | | | | | | |
| | | | | | | | |
| NEXT INSPECTION: | | | | | | | |
| RE-INSPECTION FEE DUE? VES \$ 65.00 | | | | | | | |
| IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION | | | | | | | |
| QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS: | | | | | | | |
| | ieremv.haberman @co.kittitas.wa.us | | | | | | |
| INSPECTION REQUEST LINE: www.co.kittitas.wa.us/cds/request.asp or 509-962-7694 | | | | | | | |

411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506

INSPECTION REPORT

OWNER'S NAME: IVERSON

PERMIT NUMBER: BP-15-00207

| DATE: | | 9/14/2015 | TYPE: | Re-inspection | | | |
|---|--|------------------|------------|-----------------|--|--|--|
| TIME STARTED: | | 12:50 PM | INSPECTOR: | Jeremy Haberman | | | |
| MAP NUMBER: | | 20-14-19053-0002 | | | | | |
| Pa | age 2 | | | | | | |
| 7. | 7. HDU's Must Connect to (2) Full Height Studs. This Correction Occurs Throughout. | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| INICEDIA | TIONIC | | | | | | |
| INSTRUC | HONS: | | | | | | |
| | | | | | | | |
| NEXT INSPECTION: | | | | | | | |
| RE-INSPECTION FEE DUE? NO VYES \$ 65.00 IF REQUIRED, RE-INSPECTION FEES MUST BE PAID PRIOR TO SCHEDULING A RE-INSPECTION | | | | | | | |
| QUESTIONS? PLEASE CONTACT THE INSPECTOR AT THE FOLLOWING E-MAIL ADDRESS: | | | | | | | |
| ieremv.haberman @co.kittitas.wa.us | | | | | | | |
| • INSPECTION REQUEST LINE: www.co.kittitas.wa.us/cds/request.asp or 509-962-7694 • 411 N. Ruby Street, Suite 2, Ellensburg, WA 98926 • Main Office Line: 509-962-7506 | | | | | | | |
| 121 TH May Street, Saide 2, Enchang, 1777 Source 1 Main Strice Ench 505 502 7500 | | | | | | | |